Premier Nop

Versatile and uncompromising, Premier Nop offers signature performance

Ideally suited for designers looking for style and practicality, this heavy weight material has a berber construction. If you are looking for an easy to fit, high wearing product, Premier Nop Tile is your floor covering choice.

- Made with 100% ASOTA® polypropylene fibers
- UV stable, stain resistant
- Durable and a highly resilient non-woven carpet

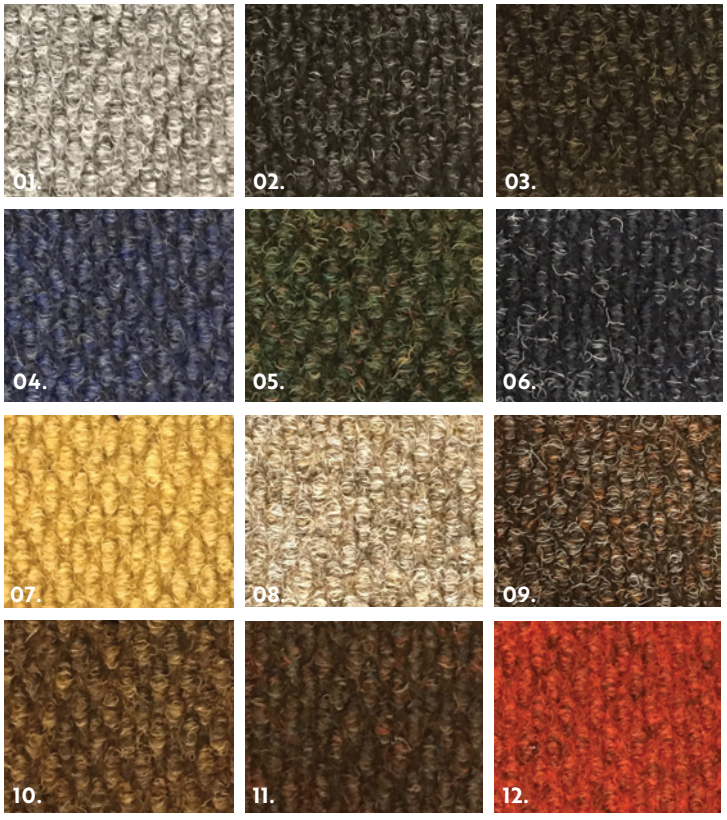

01. Sterling 2344 **02.** Anthracite 1303 **03.** Black Shadow 2343 **04.** Azure 5181
05. Aspen 6265 **06.** Midnight Sky 5154 **07.** Sisal 1399 **08.** Brown Sugar 1353
09. Cocoa 1301 **10.** Harvest 1244 **11.** Bordeaux 7178 **12.** Cardinal Red 1305

portico SYSTEMS

Solutions that Simplify.
1+ 877 285 8899 · www.porticosystems.com

Premier Nop

> 44 OZ UV STABILIZED BERBER CARPET

SUGGESTED USES
Grab-and-Go areas, entryways, runners, lobbies, retail/department stores, etc.

Manufacturing Process:	Non-woven
Surface Aspect:	Hobnail (berber) pattern
Fiber:	100% Solution-dyed UV stabilized ASOTA® polypropylene
Backing:	Premium (eco) Bitumen
Pile Height (± 0.5mm):	0.20"
Total Height (± 7.5%):	0.47"
Pile Weight (± 7.5%):	44 oz/sy
Total Weight (± 7.5%):	172 oz/sy
Tile Size (± 2%):	19.69" x 19.69"

LIMITED WARRANTY

Full Commercial Warranty	5 years

Summary of Warranty

Products must be professionally installed to validate the warranty.

Portico Systems warrants Premier Nop Carpet Tiles against wear for a period of 5 years in a commercial application. This warranty applies only to material that is properly installed and maintained, while being used as intended and recommended. If the defect is covered by this warranty and is reported to Portico Systems within the Warranty period, Portico Systems will supply new material of same or similar grade to repair or replace the defective material.

Wear
Defined as complete removal of wear layer, pattern and color due to wear from normal traffic and maintenance. If the wear occurs within 1 year from date of purchase, Portico Systems will provide replacement materials or repair, of only the effected area.

Manufacturing Defects
Portico Systems warrants Portico Nop materials are free from manufacturing defects and will replace defective floor covering and reasonable installation costs for a period of up to one [1] year from date of purchase. Portico Systems will not pay labor costs to repair or replace materials that defects were apparent before or at the time of installation.

Other Limitations

- This warranty is non-transferable
- Manufacturing defect must be reported within 3 months from date of purchase.
- This Warranty covers only properly installed & maintained floors
- Portico Systems excluded and will not pay for any consequential or incidental expenses.
- Portico Systems reserves the right of final judgment and may refuse claims in certain instances.

*For a copy of the full warranty please ask for a warranty sheet

PACKING & DIMENSIONS

Packaging:	12 tiles per box (32.5 sq.ft.)

ELECTROSTATIC PROPERTIES

Dimensional Stability (EN 986):	Pass
Electrostatic Propensity (EN 1815):	>2kV
Electrical Resistivity (IBM / ICL):	Pass, for R.H. ≥40%
Sound Insulation (ISO 10140-1:2010):	≥24dB
Thermal Retention (ISO 11092):	Permanently Anti-Static

COLOR FASTNESS

To Light (ISO 105 B02):	5
To Water (ISO 105 E01):	5
To Shampoo (ISO 105 C06):	5
To Rubbing (ISO 105 X12):	4-5 (Dry/Wet)

FLAMMABILITY RATING

Radient Panel (ASTM E648)	Class II
Smoke Density (ASTM E662)	Pass
Surface Flammability (FF 1-70 / ASTM D285)	Pass
LEED-NC	MR Credit 4 | IEQ Credits 4.1, 4.3, 5

MAINTENANCE

Regular vacuuming (Weekly in low-traffic areas, and daily or twice daily in areas with higher traffic) with a motor-driven brush and beater bar can remove up to 80% of surface dirt, and is the easiest way to prolong the life of your carpet.

Regular vacuuming is key to maintaining your carpet, but eventually the carpet color dulls from dirt and grime stuck in the fibers. The dirt is then carried further into the building to form more soil reservoirs. Additionally, the oil content (15%) of the soil causes particles to stick to carpet fiber and resist vacuuming. To restore the carpet to its best condition, frequent light cleaning gives the best result and is often very cost effective.

IMPORTANT NOTICE

Sample swatches have been cut from an overall design; decoration and shade may vary.

YOUR AUTHORIZED SALES REPRESENTATIVE:

PSIS_PREMEIERNOPSR_112618

portico SYSTEMS

experience it for yourself
Talk with your sales representative or request samples at samples@porticosystems.com

Solutions that Simplify.
1+ 877 285 8899 · www.porticosystems.com