


Synthetic Coco

The perfect alternative to Natural Coir Matting, you can project an eco-friendly image without the shedding.

The best of two worlds, Synthetic Coco offers the lush, natural look and feel of coconut coir fibers without compromise (or shedding).

- 100 % solution-dyed UV stabilized polypropylene fibers are stain and fade resistant
- Dries quickly when compared to natural cocoa mats
- Can be cut into any shape for custom mats up to 12'
- Functions best in medium to high-traffic locations, both indoor or outdoor

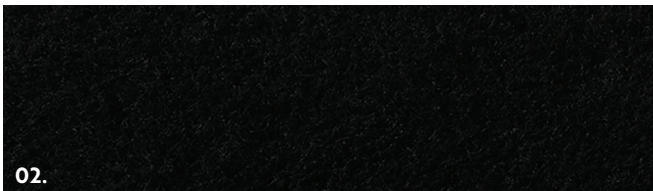

01. Natural SYN0111 02. Black SNY0211 03. Grey SYN0311



portico
SYSTEMS

Flooring Solutions that Simplify.
1+ 877 285 8899 • www.porticosystems.com



Synthetic Coco



> 44 OZ. CUSTOM + LOGO MATTING

SUGGESTED USES

Office Environments, Runners, Conference Rooms, Lobbies, Libraries, Retail/Department Stores, Entryways, etc.

Manufacturing Process:

Surface Aspect:	Non-Directional Smooth/Velour	Non-Woven
Fiber:	100% Solution-dyed UV stabilized polypropylene	
Primary Backing:		Non-Skid
Secondary Backing:		Anti-skid
Durability:	Corners patched for enforcement	
Pile Height (± 0.5mm):	0.422"	
Total Height (± 7.5%):	0.625"	
Pile Weight (± 7.5%):	44 oz./sy	
Total Weight (± 7.5%):	130 oz./sy	
Sheet/Roll Width (± 2%):	12'	

Standard Sizes


18" x 24"	3' x 5'	3' x 10'	4' x 8'	6' x 6'	6' x 12'	8' x 20'
2' x 3'	3' x 6'	3' x 12'	4' x 10'	6' x 8'	6' x 20'	12' x 12'
3' x 4'	3' x 8'	4' x 6'	4' x 12'	6' x 10'		

Custom Size Length and Width **NO SEAMS**

Length:	Up to 12'
Width:	Up to 40'

EDGING

High Profile
ADA Compliant



LIMITED WARRANTY

Full Commercial Warranty 1 year
Summary of Warranty

Portico Systems warrants Synthetic Coco Rib Custom + Logo Matting against wear for a period of 1 year in a commercial application, not including edging. This warranty applies only to material that is maintained according to our maintenance instructions. If the defect is covered by this warranty and is reported to Portico Systems within the warranty period, Portico Systems will supply new custom matting of the same or similar grade to repair or replace the defective material.

- **Wear**
Fiber loss is defined as pile reduction that exceeds 20% in any one area, or to the point the backing is showing through to the top of the mat.
- **Manufacturing Defects**
Portico Systems warrants Synthetic Coco Rib Custom + Logo Matting materials are free from manufacturing defects and will replace matting for a period of up to one (1) year from date of purchase. vG will not pay labor costs to repair or replace materials that defects were apparent before or at the time of purchase.
- **Other Limitations**
 - This warranty is non-transferable.
 - Manufacturing defect must be reported within 3 months from date of purchase.
 - This warranty covers only properly maintained mats.
 - Portico Systems excluded and will not pay for any consequential or incidental expenses.
 - Portico Systems reserves the right of final judgment and may refuse claims in certain instances.

*For a copy of the full warranty please ask for a warranty sheet.

PACKAGING & DIMENSIONS

Sheet/Roll Width (± 2%): 12'

TECHNICAL SPECIFICATIONS

Dimensional Stability (ASTM D7570-09):	Pass
Electrostatic Propensity (EN 1815):	>2kV
Electrical Resistivity (IBM / ICL):	Pass, for R.H. ≥40%
Sound Insulation (ISO 10140-1:2010):	≥21dB
Thermal Retention (ISO 11092):	0.15 m K/W Pass

COLOR FASTNESS

To Light (ISO 105 B02):	6
To Water (ISO 105 E01):	5
To Shampoo (ISO 105 C06):	5
To Rubbing (ISO 105 X12):	4 (Dry), 5 (Wet)

FLAMMABILITY RATING

Smoke Density (ASTM E662)	Pass
Surface Flammability (FF 1-70 / ASTM D28591)	Pass

LEED-NC

MR CREDIT 4 | IEQ CREDITS 4.1, 4.3, 5

MAINTENANCE

Regular vacuuming (Weekly in low-traffic areas, and daily or twice daily in areas with higher traffic) with a motor-driven brush and beater bar can remove up to 80% of surface dirt, and is the easiest way to prolong the life of your carpet. Regular vacuuming is key to maintaining your carpet, but eventually the carpet color dulls from dirt and grime stuck in the fibers. The dirt is then carried further into the building to form more soil reservoirs. Additionally, the oil content (15%) of the soil causes particles to stick to carpet fiber and resist vacuuming. To restore the carpet to its best condition, frequent light cleaning gives the best result and is often very cost effective.

IMPORTANT NOTICE

Sample swatches have been cut from an overall design; decoration and shade may vary.

YOUR AUTHORIZED SALES REPRESENTATIVE:



Experience it for yourself

Talk with your sales representative or request samples at samples@porticosystems.com

Custom Logo

Synthetic Coco