


Premier Nop

A fiberbond berber style, Premier Nop is designed to be high heel safe

A fiber bond berber style, Premier Nop is designed to be high heel safe. It traps 80% of sand, dirt, moisture and other substances, which can destroy or harm interior or exterior flooring. Premier Nop is the economical choice for high traffic applications.

- A particularly effective and stylish entrance flooring
- Perfectly at home in high-traffic environments
- Provides extra-high dirt absorption

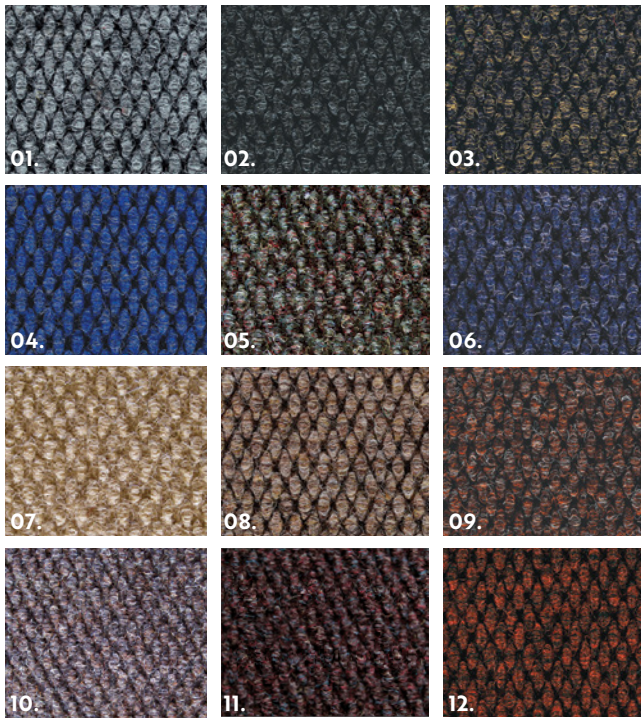

01. Sterling 2344 02. Anthracite 907 03. Black Shadow 2343 04. Azure 5181
05. Aspen 6265 06. Midnight Blue 5154 07. Sisal 1099 08. Beige 918 09. Chocolate 912
10. Harvest 1244 11. Bordeaux 7178 12. Cardinal Red 3353



portico
SYSTEMS

Solutions that Simplify.

1+ 877 285 8899 · www.porticosystems.com

Carpet/Roll Goods

Premier Nop

Premier Nop



> 44 OZ NEEDLEPUNCHED CONTRACT CARPET

SUGGESTED USES

Office Environments, Runners, Conference Rooms, Lobbies, Libraries, Retail/Department Stores, Entryways, etc.

Manufacturing Process:	Non-woven/needlepunched
Surface Aspect:	Hobnail (berber) pattern
Fiber:	100% Solution-dyed UV stabilized ASOTA® polypropylene
Backing:	Premium composite rubber
Pile Height (± 0.5mm):	0.18"
Total Height (± 7.5%):	0.47"
Pile Weight (± 7.5%):	44 oz/sy
Total Weight (± 7.5%):	65 oz/sy
Sheet/Roll Width (± 2%):	6' 7" or 13' 2"

LIMITED WARRANTY

Full Commercial Warranty	5 years
Summary of Warranty	

Products must be professionally installed to validate the warranty.

Portico Systems warrants Premier Nop Sheet/Roll Goods against wear for a period of 5 years in a commercial application. This warranty applies only to material that is properly installed and maintained, while being used as intended and recommended. If the defect is covered by this warranty and is reported to Portico Systems within the Warranty period, Portico Systems will supply new material of same or similar grade to repair or replace the defective material.

- **Wear**
Defined as complete removal of wear layer, pattern and color due to wear from normal traffic and maintenance. If the wear occurs within 5 years from date of purchase, Portico Systems will provide replacement materials or repair, of only the effected area.
- **Manufacturing Defects**
Portico Systems warrants Premier Nop materials are free from manufacturing defects and will replace defective floor covering and reasonable installation costs for a period of up to one [1] year from date of purchase. Portico Systems will not pay labor costs to repair or replace materials that defects were apparent before or at the time of installation.
- **Other Limitations**
 - This warranty is non-transferable
 - Manufacturing defect must be reported within 3 months from date of purchase.
 - This Warranty covers only properly installed & maintained floors
 - Portico Systems excluded and will not pay for any consequential or incidental expenses.
 - Portico Systems reserves the right of final judgment and may refuse claims in certain instances.

*For a copy of the full warranty please ask for a warranty sheet

PACKING & DIMENSIONS

Sheet/Roll Width (± 2%):	6' 7" or 13' 2"
--------------------------	-----------------

TECHNICAL SPECIFICATIONS

Dimensional Stability (ASTM D7570-09):	Pass
Electrostatic Propensity (EN 1815):	>2kV
Electrical Resistivity (IBM / ICL):	Pass, for R.H. ≥40%
Sound Insulation (ISO 10140-1:2010):	≥21dB
Thermal Retention (ISO 11092):	0.15 m K/W Pass

COLOR FASTNESS

To Light (ISO 105 B02):	5
To Water (ISO 105 E01):	5
To Shampoo (ISO 105 C06):	4-5
To Rubbing (ISO 105 X12):	4 (Dry), 3-4 (Wet)

FLAMMABILITY RATING

Smoke Density (ASTM E662)	Pass
Surface Flammability (FF 1-70 / ASTM D2859)	Pass

LEED-NC MR Credit 4 | IEQ Credits 4.1, 4.3, 5

MAINTENANCE

Regular vacuuming (Weekly in low-traffic areas, and daily or twice daily in areas with higher traffic) with a motor-driven brush and beater bar can remove up to 80% of surface dirt, and is the easiest way to prolong the life of your carpet.

Regular vacuuming is key to maintaining your carpet, but eventually the carpet color dulls from dirt and grime stuck in the fibers. The dirt is then carried further into the building to form more soil reservoirs. Additionally, the oil content (15%) of the soil causes particles to stick to carpet fiber and resist vacuuming. To restore the carpet to its best condition, frequent light cleaning gives the best result and is often very cost effective.

IMPORTANT NOTICE

Sample swatches have been cut from an overall design; decoration and shade may vary.

YOUR AUTHORIZED SALES REPRESENTATIVE:



experience it for yourself
Talk with your sales representative or request samples at samples@porticosystems.com

Solutions that Simplify.

1+ 877 285 8899 • www.porticosystems.com

Carpet/Roll Goods

Premier Nop